



Zakład Szybowcowy „Jeżów”
Henryk Mynarski
58-521 Jeżów Sudecki
ul. Długa 93
tel/fax: +48 75 713 21 59
szd_jezow@szdjezow.com.pl

SERVICE INFORMATION LETTER

DATE 04 august 2017 SIL-005/ZSJ/2017

SUBJECT: Control of elevator pushrod fork tip

CONCERNS: SZD 9 bis Bocian 1E , D , C

COMPLIANCE DATE: mandatory after reciving this letter .

ATTENTION!

Please read this documents carefully to avoid misunderstandings and errors

Guidelines on implementation of this SIL

Control of elevator pushrod fork tip.


Open inspection hole located in left back part of fuselage.

By the mirror or inspection camera check condition adjustable pushrod tip per circuit.


Any damage or curvature of tip eliminate possible to fly until replace the tip.

.ATTENTION

Please check protection of elevator during airfield transport. Unsafely elevator can provide to uncontrolled impact pushrod in to intermediate lever. This can entail curve or crack of tip Any repair or straighten pushrod fork tip is forbidden.

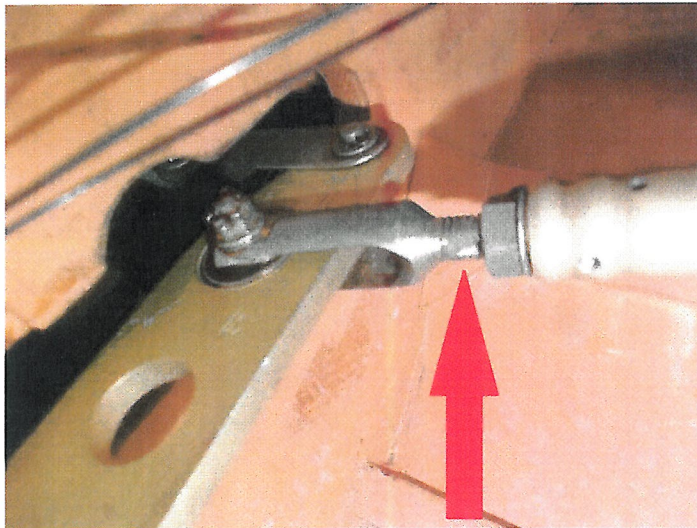

Elaborated:

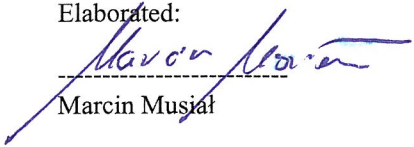

Marcin Musiał

Approved:



Henryk Mynarski